RECOVERY, TRANSPORTATION AND ACCEPTANCE TO THE CURATION FACILITY OF THE HAYABUSA RE-ENTRY CAPSULE. M. Abe^{1,2}, A. Fujimura^{1,2}, H. Yano^{1,2}, C. Okamoto², T. Okada^{1,2}, T. Yada², Y. Ishibashi², K. Shirai², T. Nakamura³, T. Noguchi⁴, R. Okazaki⁵, M. Zolensky⁶, S. Sandford⁷, T. Ireland⁸, M. Ueno¹, T. Mukai⁹, M. Yoshikawa^{1,2}, T. Yamada^{1,2}, H. Kuninaka^{1,2}, and J. Kawaguchi^{1,2}, ¹Institute of Space and Astronautical Science, Japan Aerospace Exploration Agency (3-1-1 Yoshinodai, Chuo-ku, Sagamihara-shi, Kanagawa-ken 252-5210, Japan; abe@planeta.sci.isas.ac.jp), ²JAXA Space Exploration Center, Japan Aerospace Exploration Agency (3-1-1 Yoshinodai, Chuo-ku, Sagamihara-shi, Kanagawa-ken 252-5210, Japan), ³Tohoku University (Department of Earth and Planetary Materials Science, Faculty of Science, Tohoku University, Aramaki, Aoba, Sendai, Miyagi 980-8578,Japan), ⁴Ibaraki University (Department of Earth and Planetary Sciences, Faculty of Sciences, Kyushu University, Hakozaki, Fukuoka 812-8581, Japan), ⁶Johnson Space Center, National Aeronautics and Space Administration (Astromaterials Research and Exploration Science, KT, NASA Johnson Space Center, Houston, TX 77058, USA), ⁷Ames Research Center, National Aeronautics and Space Administration (Astrophysics Branch, Mail Stop 245-6, Bldg N245, Room 112, NASA-Ames Research Center, Moffett Field, CA 94035, USA), ⁸Australian National University (Research School of Earth Sciences, College of Physical and Mathematical Sciences, The Australian National University, Canberra ACT 0200, Australia), ⁹Japan Aerospace Exploration Agency (3-1-1 Yoshinodai, Chuo-ku, Sagamihara-shi, Kanagawa-ken 252-5210, Japan).

Introduction: The 'Hayabusa' re-entry capsule was safely carried into the clean room of Sagamihara Planetary Sample Curation Facility in JAXA on June 18, 2010. After executing computed tomographic (CT) scanning, removal of heat shield, and surface cleaning of sample container, the sample container was enclosed into the clean chamber. After opening the sample container and residual gas sampling in the clean chamber, optical observation, sample recovery, sample separation for initial analysis will be performed. This curation work is continuing for several manths with some selected member of Hayabusa Asteroidal Sample Preliminary Examination Team (HASPET). We report here on the 'Hayabusa' capsule recovery operation, and transportation and acceptance at the curation facility of the 'Hayabusa' re-entry capsule.

Capsule recovery operation: On June 13, 2010, the Hayabusa spacecraft and its re-entry capsule returned to the Earth, and separation of the capsule occurred at 19:51(JST). At 22:51, both the spacecraft and the capsule entered the Earth's atmosphere and the spacecraft was burned up. After the thermal shields separated from the re-entry capsule and parachute deployed at 22:56, the capsule landed on the ground and began sending out a radio beacon at 23:08. A helicopter, assisted by information from four direction finding gound sites, discovered the capsule at 23:56. The landing point was almost the exact center of predicted ellipse within the Woomera Prohibited Area because of weak wind. The final recovery of the capsule was performed on the following day, June 14, including special safety operations at the landing point.

At the landing point, acquisition of scientific documentary photography, collection of the circumference soil sample, and packaging the capsule into the temporally plastic bag and transportation box were performed (Fig. 1). The recovery capsule was then transported to the Woomera Headquarters building with temporary cleanroom facilities. One day was spent on the removal of the explosive device and the battery in the capsule. The next day was spent on the removal of contaminants adhering to the capsule and the packing the capsule into a transportation box (Fig. 2). The surface cleaning of the capsule and packing operation were both executed in the temporary cleanroom installed in the building. The transportation box has a purge function of pure nitrogen gas, and can ease the shock under transportation. On the afternoon of June 17, the capsule was flown from Woomera's airfield in Australia, which is the nearest airport from the headquarters building, to Haneda airport in Japan in a direct flight (Fig. 3).



Fig. 1: The re-entry capsule at the landing site before its recovery.

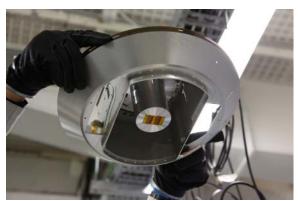


Fig. 2: The re-entry capsule after safety operation at the headquarters building.



Fig. 3: Arrival in Japan of the capsule transportation box

Curation work: Since the sample container was not allowed to be opened for inspection at the airport, special considerations were carried out in quarantine and customs procedures. The transportation box was carried into the Sagamihara Planetary Sample Curation Facility in JAXA at 2:00 on June 18.

After opening the transportation box on which the sticker was stuck by the quarantine officer of Australia, the capsule was removed from the transportation box and photographically documented. This procedure was followed by X ray CT imaging of the capsule.

After taking the CT images, the sample container was removed from the capsule using a milling machine in the clean room. It was now 34 hours after domestic arrival. After that, surface cleaning and evaluation of the sample container took an additional 21 hours. For surface cleaning of the sample container, besides dry nitrogen gas spraying and wiping wwith cloth, a small vacuum cleaner, dry ice snow blasting machine and atmospheric pressure plasma equipment were used. Observation by optical microscope, contact angle measurement, and FTIR measurements were carried out for evaluation after cleaning.

After cleaning of the sample container, using the container opening jigs, the container opening system with the sample container was installed to the clean chamber. Installation of the sample container to the clean chamber (Fig. 4), in which the gas environment was controlled, was completed in 63 hours after domestic arrival.

The sample container had been sealed with double Viton O-rings, but as expected, terrestrial air slowly leaked inside. Since the concentration of terrestrial air in the container would increase with time, the sample container was placed into a ultra pure nitrogen atmosphere as soon as was reasonably possible. Since all day continuous operation was carried out after the domestic arrival, the sample container was able to be installed into the clean chamber within one week after parachute deployment.

Fortunately the work of the curation facility is being conducted as sown in the scheduled flowchart (Fig. 5). This is because the capsule landed as planned and was recovered quickly, and the sample container was not damaged.



Fig. 4: Clean chamber of the Sagamihara Planetary Sample Curation Facility in JAXA.

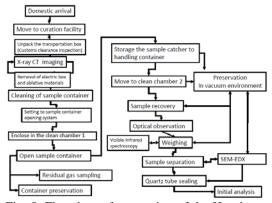


Fig. 5: Flowchart of processing of the Hayabusa sample container from domestic arrival to preliminary analysis of the sample